



## Dry Contact Relay Kit

RELAYCARD-SDU



## Instruction Manual

Gross Automation (877) 268-3700 · [www.solahevidutysales.com](http://www.solahevidutysales.com) · [sales@grossautomation.com](mailto:sales@grossautomation.com)

Gross Automation (877) 268-3700 · [www.solahevidutysales.com](http://www.solahevidutysales.com) · [sales@grossautomation.com](mailto:sales@grossautomation.com)

While every precaution has been taken to ensure accuracy and completeness in this manual, Sola/Hevi-Duty assumes no responsibility, and disclaims all liability for damages resulting from use of this information or for any errors or omissions.

©2007 Sola/Hevi-Duty. All rights reserved throughout the world. Specifications are subject to change without notice.

®Sola/Hevi-Duty name and logo are registered trademarks of EGS Electrical Group, LLC. All names referred to are trademarks or registered trademarks of their respective owners.

# Table of Contents

Pre-Installation .....	4
Installation .....	4
Product Description .....	5-6
Notes .....	7

# Pre-Installation

## Components Supplied with the Dry Contact Relay Kit

- One dry contact relay box
- One interface cable (DB 9 connector)
- One 12 V dc power interconnection cable
- Four M3 mounting screws

# Installation




**Only qualified personnel should install or service this system. Electrical safety precautions must be followed when installing or servicing this equipment. To prevent risk of electrical shock, turn off and lock out all power sources to the unit before making electrical connections.**

## Mounting Procedure

1. Using the four M3 screws provided, mount the dry relay box on the right side of the SDU UPS. If mounting on a separate chassis, the hole diameter for the relay box is 0.378 in. (3.5 mm).
2. Plug the 12 V dc power interconnection cable into the 12 V dc output of the SDU UPS. Plug the other end of the power interconnection cable into the input of the relay box.
3. Plug the DB 9 connector cable into the RS232 communication port of the SDU UPS. Plug the other end of the connector into the remote port of the dry contact relay.

# Product Description

## Front and Rear Views

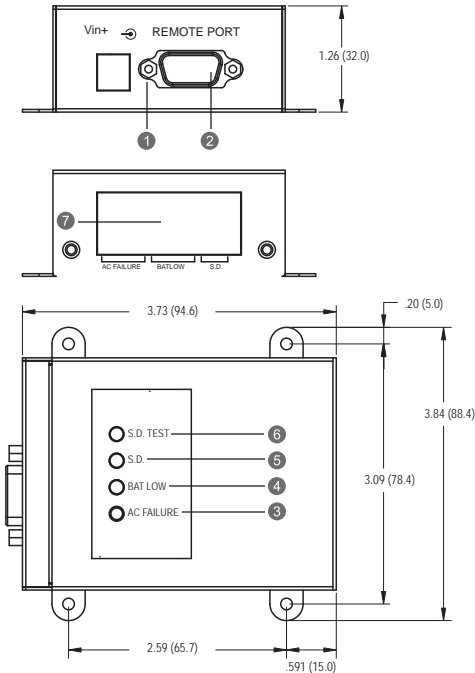


All dimensions are in inches (mm)

- 1. Vin:** Input connector used to provide the dry contact relay with 12 V dc input power.
- 2. Remote Port:** The communication port is used for linking to the SDU UPS.  
**Note:** The provided connection cable is used only for this dry contact relay.
- 3. AC Failure Indicator:** This yellow LED is illuminated when ac voltage is abnormal.
- 4. Battery Low Indicator:** This green LED is illuminated when battery capacity is low.
- 5. Shut Down Indicator (S.D.):** When the dry contact relay receives the shut down signal for 1 second, the red LED is illuminated and the SDU UPS goes into the shut down mode.

**6. Shut Down Test Button (S.D. Test):** Provides the dry contact relay a shut down signal to test the shut down function when the UPS is operating in the battery mode. Push this button for 1 second and the red LED is illuminated. The SDU UPS goes into the shut down mode after 3 minutes.

**7. 8 Pole Terminal Blocks**

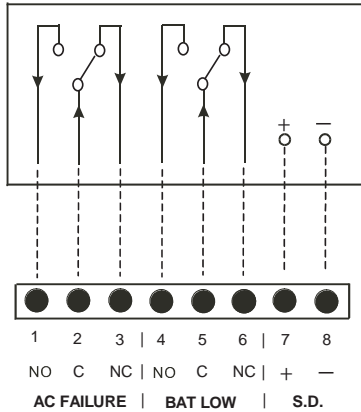

Terminal Block, Layout and Operation									
+UPS State		External Input	DCB LED Display			Terminal Blocks			
O = Occur X = Does not occur		O = Enable X = Disable	O = LED On X = LED Off			O = Close X = Open			
Ac Failure	BAT Low	S.D.	Yellow	Green	Red	Pin 1-2	Pin 2-3	Pin 4-5	Pin 5-6
X	X	X	X	X	X	X	O	X	O
O	X	X	O	X	X	O	X	X	O
O	O	X	X	O	X	O	X	O	X
O	X	O	X	X	O	X	O	X	O

## Notes

1. Suitable electric wire = AWG 22–12 (IEC 2.5 mm)
2. Contact maximum current = 1.0 A @ 250 V ac
3. Shut down input signal (range = +5 V to +12 V) can be provided by enabling terminals 7 and 8 for remote shut down control, assured by an external remote device.



Gross Automation (877) 268-3700 · [www.solahevidutysales.com](http://www.solahevidutysales.com) · [sales@grossautomation.com](mailto:sales@grossautomation.com)

Part Number: A272-081 Rev 6  
February 28, 2008